



Studebaker

AUTOMOTIVE SALES CORPORATION
SOUTH BEND 27, INDIANA

Service Letter

PARTS AND SERVICE

SUBJECT RELOCATION OF ELECTRICAL CONTROL UNITS
1963 WAGONAIRE W/ELECTRIC TAIL GATE WINDOW

FROM C. R. McIntosh, Manager
Passenger Car Technical Service

NUMBER J-1963-12

DATE April 30, 1963

Effective with serial numbers 63S-26025 and 63V-24019 the voltage regulator, tail gate window lift relay and circuit breaker on 1963 Wagonaire models equipped with an electrically operated tail gate window have been relocated further forward on the left front fender apron to eliminate possible interference between the wiring and the hood torsion bar linkage.

You should inspect all 1963 Wagonaire models with electrically operated tail gate windows for interference at this point when the vehicle is in your service department. If interference exists, the voltage regulator, lift relay and circuit breaker should be repositioned as indicated in Figure 1. After relocation of these units, the unused holes in the fender apron should be plugged.

CRM/et

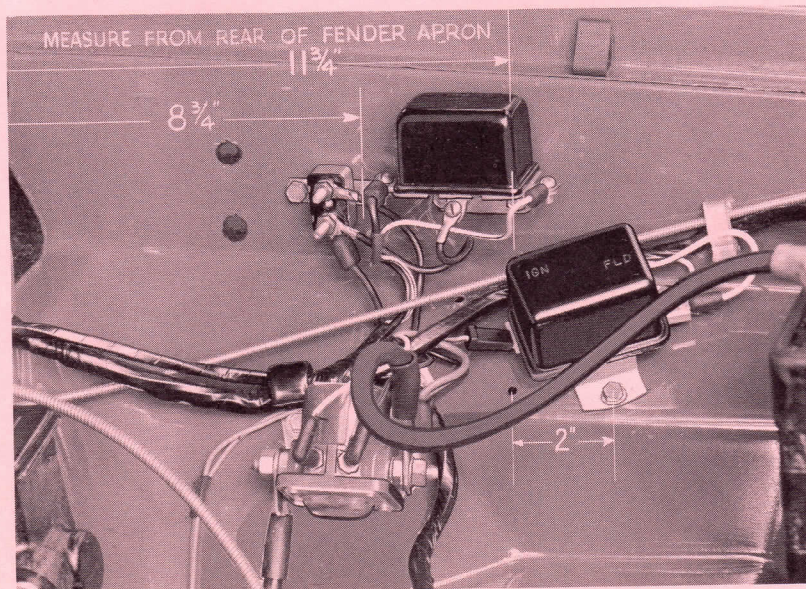


Fig. 1